


REFERENCE	NI_2014_X98CUP_01_UK
DATE	3rd February, 2014
SUBJECT	OFFSEASON Information

CONCERNED : ALL CHAMPIONSHIPS

• **COLD START PROCEDURE**

Following customer comments regarding the difficulty to start the car in cold condition, we would like to advise you about the correct cold start procedure:

1. Be sure that the battery is fully loaded. For the first start, you can place a jump battery to help on-board battery.
2. Unplug the HP pump command (connector circled in red below) and switch ON the ignition command. START twice. Thus, spark plugs will heat.

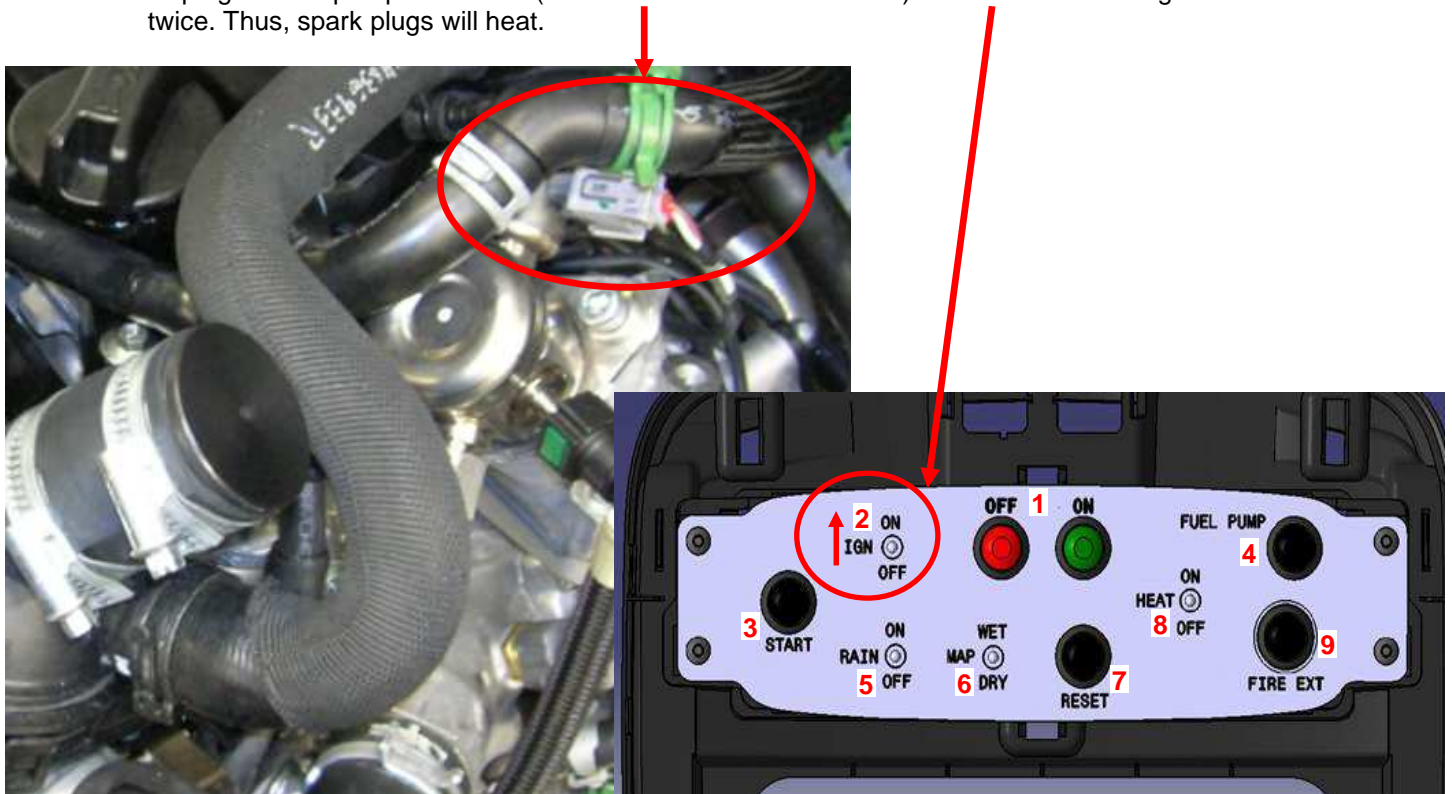


3. Plug the HP pump and start. Using cleaned or new spark plugs will help you to start properly.

We are currently working on this matter, and will provide you a new mapping solving cold condition start issues before the first meetings of each championships.

- **GEARBOX ACTUATOR**

As mentioned in the Information Note N.8/2013, we strongly advise you to rebuild the gearbox actuator every 6,000km. You will find below the information you need to perform this rebuild:

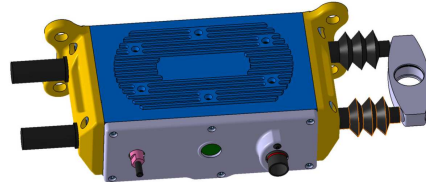

The rebuild **must** be performed by XAP Electronics, it is strictly **forbidden to do it by yourself** (seals are present on the actuator).

Price of the rebuild: **200€** excl VAT

This price includes:

- Removing, cleaning and re-assembly of all the internal components
- Bearings change
- General inspection of each components
- Performance control on a test bench

Shipment address:

XAP Technology SAS
298, rue des Entrepreneurs
30420 Calvisson
FRANCE

NOTE: Before sending any actuator, you have to contact the XAP after sales service responsible:

Samir ALIMOUSSA
alimoussa@xap.fr
(+33) 4 66 02 94 95

- **2014 upgrade kits**

Due to suppliers delay and kit composition modifications, the upgrade campaign is postponed to mid-end of February. As explain on Information Note n.8, we have worked on a defusing system with ATL[®]. This system uses Venturi effect, so no electrical modification is applied to the pump which we believe is a lot safer and even more efficient. More information will come as soon as possible.

